

Work Order ID 150877

Thursday, September 08, 2016 3:16:37 PM

U/R

150877

AOG Ship Nov 4

Page 1

Item ID: D119-646-041

Accept

N9000040100

Setup Start *NS1*

Revision ID: URF 15-560

Stop *NS2*

Item Name: AW119 Replacement Skidtube with Wearpads - Fits LH or RH

Start Date: 11/2/2016 Start Qty: 1.00

1

Cust Item ID:

Required Date: 11/23/2016 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan: dm Date: SEP 08 2016

Tooling:

Date:

QC:

Date:

SPC (Y/N):

Date:

Run Start *NR1*

Stop *NR2*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
Draw Nbr	Revision Nbr								
D3887-041	D								
IIN-D119-646	C								

100

0.00

100

DC

Doc.Control -USB or Paperwork

Memo

0.00

Photocopy bluefile & type labels per PPP D119-646-041 CHG004

N/A ^{DAS} 21 ₉₋₈₉ NOV 02 2016

110

0.00

110

Skidtubes

Skidtubes

Memo

0.00

1- inspect Mat'L D2500-1-190 for damage

2-Cut tube to length as per dwg D3887 (154.8")

3- Ensure squareness of ends and scribe batch#

16-10-13

DQA: _____ Date: _____

**WORK ORDER NON-CONFORMANCE / UPDATE**

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS <table style="width:100%; border: none;"> <tr> <td style="width:15%;">Skid-tube ☐</td> <td style="width:15%;">Cross tube ☐</td> <td style="width:15%;">Water Jet ☐</td> <td style="width:15%;">Engineering ☐</td> </tr> <tr> <td>Machining ☐</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coord. ☐</td> <td>Quality ☐</td> </tr> <tr> <td>Thermoforming ☐</td> <td>Finishing ☐</td> <td>Rec/Store/Packaging ☐</td> <td>Other ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Composite ☐</td> <td>Supplier ☐</td> <td></td> </tr> </table>						Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐																						
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐																						
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐																						
Large Fab ☐	Composite ☐	Supplier ☐																							
Date : _____		Step #: _____		QTY Effective : _____			MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval																		
Description Work Order Deviation				Disposition																					

Root Cause				FAULT CATEGORY			
Environment ☐	Design ☐	Doc/Data ☐	Equip/Tooling ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐
Handling/Pre ☐	Material ☐	Internal Transport ☐	Tribal Knowledge ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐
LOA ☐	Substation ☐	Past Expiry Date ☐	Misidentified ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐
				Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐
				Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐
				Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐
				Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐
				Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐
				Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐
				Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐
No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐				OTHER : _____			

Work Order ID 150877***150877***

Page 2

Thursday, September 08, 2016 3:16:37 PM

Item ID: D119-646-041 Accept

N900040100Setup Start ***NS1***

Revision ID: URF 15-560

Stop ***NS2***

Item Name: AW119 Replacement Skidtube with Wearpads - Fits LH or RH

Start Date: 11/2/2016 Start Qty: 1.00 ***1***

Cust Item ID:

Required Date: 11/23/2016 Req'd Qty: 1.00 ***1***

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

120

Chemical Conversion Coat per QSI005 4.1

0.00

120

HandFinish

Memo

0.00

Hand Finishing

(x1) ✓ 2016/10/18
BEB

121

QC7-Inspect Chemical Conversion Coat

0.00

121

QC

Memo

0.00

Quality Control

1 ✓ 16-10-19 ✓

122

QC5- Inspect part completeness to step on W/O

0.00

122

QC

Memo

0.00

Quality Control

1 ✓ 16-10-19

DAS
18
9-89

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS <table style="width: 100%; border: none;"> <tr> <td style="width: 15%;">Skid-tube ☐</td> <td style="width: 15%;">Cross tube ☐</td> <td style="width: 15%;">Water Jet ☐</td> <td style="width: 15%;">Engineering ☐</td> </tr> <tr> <td>Machining ☐</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coord. ☐</td> <td>Quality ☐</td> </tr> <tr> <td>Thermoforming ☐</td> <td>Finishing ☐</td> <td>Rec/Store/Packaging ☐</td> <td>Other ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Composite ☐</td> <td>Supplier ☐</td> <td></td> </tr> </table>						Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐																																							
Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐																																																												
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐																																																												
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐																																																												
Large Fab ☐	Composite ☐	Supplier ☐																																																													
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval																																																								
Description Work Order Deviation				Disposition				Completed By																																																							
								Lead hand / Supervisor Approval Verification																																																							
								QC / QA Coordinator Approval																																																							
Root Cause		FAULT CATEGORY																																																													
Environment ☐	Design ☐	Doc/Data ☐	Equip/Tooling ☐	Handling/Pre ☐	Material ☐	Internal Transport ☐	Tribal Knowledge ☐	LOA ☐	Substation ☐	Past Expiry Date ☐	Misidentified ☐	No Re-verification ☐	Operator ☐	Offset/Setup ☐	Supplier ☐	Training ☐	Use for Testing ☐	Poor Information ☐	Rushing ☐	Product Improvement ☐	Process Improvement ☐	Manufacturing Process ☐	Past Due ☐	Pressure/Forced ☐	Bending ☐	Centre Not Concentric ☐	Cracks ☐	Crimp/Kink/Ripple/Wave ☐	Cuffs ☐	Crushing ☐	Heat Treat ☐	Wave/Twist in Tube ☐	Marks/Chatter ☐	Temperature/Cure ☐	Set-up ☐	BOM/Route ☐	Broken/Damage/Defect ☐	Inspection Incomplete/Unqualified ☐	Contamination ☐	Countersink ☐	Cut Too Short ☐	Instructions Incomplete/Unclear ☐	Drill Holes ☐	Power Loss/Surge ☐	Folio/Program ☐	Grain ☐	Weld ☐	Wrong Stock Pulled ☐	Out of Sequence ☐	Off-set ☐	Mislabeled ☐	Fit/Function ☐	Misaligned/off center ☐	Positioned Wrong ☐	Outside Dimensions ☐	Over/Under tolerance ☐	Part Incorrect ☐	Part Lost/Missing ☐	Part Moved ☐	Drawing ☐	Finish ☐	Misread ☐	Turning Sequence ☐
OTHER : _____																																																															

Work Order ID 150877***150877***

Page 3

Thursday, September 08, 2016 3:16:37 PM

Item ID: D119-646-041 Accept ***N900040100*** Setup Start ***NS1***
Revision ID: URF 15-560 Stop ***NS2***
Item Name: AW119 Replacement Skidtube with Wearpads - Fits LH or RH
Start Date: 11/2/2016 Start Qty: 1.00 ***1*** Cust Item ID:
Required Date: 11/23/2016 Req'd Qty: 1.00 ***1*** Customer:
Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

130

0.00

130

Skidtubes

Skidtubes

Memo

0.00

1- Install drill Jig DT9477 drill X-bolt spacer pilot holes using 3/16" drill first side only.

2- 2nd side, locating from first saddle holes use DT9861 A/B to drill 2nd side fwd saddle holes.

3- 2nd side locating from fwd saddle drill remaining crossbolt spacer holes using DT9477

4- Open crossbolt spacer holes to finished size as per dwg D3887 (section D-D and E-E) ***DO NOT OPEN FWD Saddles Holes***

5- Deburr, blow out chips from inside of tube.

6- Bond web in place as per Dwg D3887 & QSI 015.

A/RSikaflex-291 B135772Sikaflex expire date: 12-02-16Start: _____ Time: 8:45Finish: _____ Time: 9:10

***** (Adhere for 12 hours) *****

16-10-19 *JK*16-10-20 *DT JK*

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS <table style="width:100%; border: none;"> <tr> <td style="width:15%;">Skid-tube ☐</td> <td style="width:15%;">Cross tube ☐</td> <td style="width:15%;">Water Jet ☐</td> <td style="width:15%;">Engineering ☐</td> </tr> <tr> <td>Machining ☐</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coord. ☐</td> <td>Quality ☐</td> </tr> <tr> <td>Thermoforming ☐</td> <td>Finishing ☐</td> <td>Rec/Store/Packaging ☐</td> <td>Other ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Composite ☐</td> <td>Supplier ☐</td> <td></td> </tr> </table>						Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐																						
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐																						
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐																						
Large Fab ☐	Composite ☐	Supplier ☐																							
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval																		
Description Work Order Deviation				Disposition																					

Root Cause				FAULT CATEGORY			
☐ Environment	☐ Design	☐ Doc/Data	☐ Equip/Tooling	☐ Pressure/Forced	☐ Temperature/Cure	☐ Power Loss/Surge	☐ Positioned Wrong
☐ Handling/Pre	☐ Material	☐ Internal Transport	☐ Tribal Knowledge	☐ Bending	☐ Set-up	☐ Folio/Program	☐ Outside Dimensions
☐ LOA	☐ Substation	☐ Past Expiry Date	☐ Misidentified	☐ Centre Not Concentric	☐ BOM/Route	☐ Grain	☐ Over/Under tolerance
☐ No Re-verification	☐ Operator	☐ Offset/Setup	☐ Supplier	☐ Cracks	☐ Broken/Damage/Defect	☐ Weld	☐ Part Incorrect
☐ Training	☐ Use for Testing	☐ Poor Information	☐ Rushing	☐ Crimp/Kink/Ripple/Wave	☐ Inspection Incomplete/Unqualified	☐ Wrong Stock Pulled	☐ Part Lost/Missing
☐ Product Improvement	☐ Process Improvement	☐ Manufacturing Process	☐ Past Due	☐ Cuffs	☐ Contamination	☐ Out of Sequence	☐ Part Moved
				☐ Crushing	☐ Countersink	☐ Off-set	☐ Drawing
				☐ Heat Treat	☐ Cut Too Short	☐ Mislabeled	☐ Finish
				☐ Wave/Twist in Tube	☐ Instructions Incomplete/Unclear	☐ Fit/Function	☐ Misread
				☐ Marks/Chatter	☐ Drill Holes	☐ Misaligned/off center	☐ Turning Sequence
OTHER : _____							

Work Order ID 150877***150877***

Page 4

Thursday, September 08, 2016 3:16:37 PM

Item ID: D119-646-041 Accept ***N900040100*** Setup Start ***NS1***
Revision ID: URF 15-560 Stop ***NS2***
Item Name: AW119 Replacement Skidtube with Wearpads - Fits LH or RH
Start Date: 11/2/2016 Start Qty: 1.00 ***1*** Cust Item ID:
Required Date: 11/23/2016 Req'd Qty: 1.00 ***1*** Customer:
Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

135

QC5- Inspect part completeness to step on W/O

0.00

135

QC

Memo

0.00

Quality Control

DAS
18
9-891 0 16-10-26

DQA: _____ Date: _____

**WORK ORDER NON-CONFORMANCE / UPDATE**

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval		
Description Work Order Deviation				Disposition					

Root Cause			FAULT CATEGORY		
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐
Past Expiry Date ☐	Manufacturing Process ☐	OTHER :			
Misidentified ☐	Past Due ☐				

Work Order ID 150877***150877***

Page 5

Thursday, September 08, 2016 3:16:37 PM

Item ID: D119-646-041 Accept ***N900040100*** Setup Start ***NS1***
Revision ID: URF 15-560 Stop ***NS2***
Item Name: AW119 Replacement Skidtube with Wearpads - Fits LH or RH
Start Date: 11/2/2016 Start Qty: 1.00 ***1*** Cust Item ID:
Required Date: 11/23/2016 Req'd Qty: 1.00 ***1*** Customer:
Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

140

140

Skidtubes

Skidtubes

Memo

0.00

- 1- Bend FWD end of tube using bender 1 and FOLIO 31 bend prog. D3887.***Must use bending aid DT9544, ensure proper positioning***
- 2- Cut FWD end of tube as per dwg D3887.***Verify measurment***
- 3- Buff out marks left from bending
- 4- Drill FWD cap holes using DT8215. Open FWD & AFT cap holes to 0.208"
- 5- Open FWD saddle holes to finished size as per dwg D3887
- 6- Drill FWD x-bolt spacer holes using DT9816 and open to finished size.(verify measurement)
- 7- Drill Tow ring hole, using DT10047 locate from FWD saddle hole. (verify measurement). Open to finished size.
- 8- Drill 1.87" and 3.74 holes using DT10045 A&B locate from FWD saddle hole. (verify measurement) as per dwg.
- 9- C'sink FWD cap hole as per detail "C"
- 10- Drill holes for wearpads using DT8931, open to 0.297".
- 11- Countersink crossbolt spacer holes, and prepare tube for welding, deburr.
- 12- Deburr and blow out chips from inside of tube.

16-10-21 JH/KR

16-10-24

DAS
19
9-89

DQA: _____ Date: _____

**WORK ORDER NON-CONFORMANCE / UPDATE**

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval		
Description Work Order Deviation				Disposition					

Root Cause				FAULT CATEGORY																																																											
☐ Environment	☐ Design	☐ Doc/Data	☐ Equip/Tooling	☐ Handling/Pre	☐ Material	☐ Internal Transport	☐ Tribal Knowledge	☐ LOA	☐ Substation	☐ Past Expiry Date	☐ Misidentified	☐ No Re-verification	☐ Operator	☐ Offset/Setup	☐ Supplier	☐ Training	☐ Use for Testing	☐ Poor Information	☐ Rushing	☐ Product Improvement	☐ Process Improvement	☐ Manufacturing Process	☐ Past Due	☐ Pressure/Forced	☐ Bending	☐ Centre Not Concentric	☐ Cracks	☐ Crimp/Kink/Ripple/Wave	☐ Cuffs	☐ Crushing	☐ Heat Treat	☐ Wave/Twist in Tube	☐ Marks/Chatter	☐ Temperature/Cure	☐ Set-up	☐ BOM/Route	☐ Broken/Damage/Defect	☐ Inspection Incomplete/Unqualified	☐ Contamination	☐ Countersink	☐ Cut Too Short	☐ Instructions Incomplete/Unclear	☐ Drill Holes	☐ Power Loss/Surge	☐ Folio/Program	☐ Grain	☐ Weld	☐ Wrong Stock Pulled	☐ Out of Sequence	☐ Off-set	☐ Mislabeled	☐ Fit/Function	☐ Misaligned/off center	☐ Positioned Wrong	☐ Outside Dimensions	☐ Over/Under tolerance	☐ Part Incorrect	☐ Part Lost/Missing	☐ Part Moved	☐ Drawing	☐ Finish	☐ Misread	☐ Turning Sequence
																								OTHER : _____																																							

Work Order ID 150877***150877***

Page 6

Thursday, September 08, 2016 3:16:37 PM

Item ID: D119-646-041 Accept ***N900040100*** Setup Start ***NS1***
Revision ID: URF 15-560 Stop ***NS2***
Item Name: AW119 Replacement Skidtube with Wearpads - Fits LH or RH
Start Date: 11/2/2016 Start Qty: 1.00 ***1*** Cust Item ID:
Required Date: 11/23/2016 Req'd Qty: 1.00 ***1*** Customer:
Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
150	QC5- Inspect part completeness to step on W/O	0.00							
150									
QC	Memo	0.00							
Quality Control									

DAS
18
9-89

/ 0 / 610-24

DQA: _____ Date: _____

**WORK ORDER NON-CONFORMANCE / UPDATE**

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS <table style="width:100%; border: none;"> <tr> <td style="border: none;">Skid-tube ☐</td> <td style="border: none;">Cross tube ☐</td> <td style="border: none;">Water Jet ☐</td> <td style="border: none;">Engineering ☐</td> </tr> <tr> <td style="border: none;">Machining ☐</td> <td style="border: none;">Small Fab ☐</td> <td style="border: none;">Prod. Eng. Coord. ☐</td> <td style="border: none;">Quality ☐</td> </tr> <tr> <td style="border: none;">Thermoforming ☐</td> <td style="border: none;">Finishing ☐</td> <td style="border: none;">Rec/Store/Packaging ☐</td> <td style="border: none;">Other ☐</td> </tr> <tr> <td style="border: none;">Large Fab ☐</td> <td style="border: none;">Composite ☐</td> <td style="border: none;">Supplier ☐</td> <td></td> </tr> </table>						Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐																						
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐																						
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐																						
Large Fab ☐	Composite ☐	Supplier ☐																							
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval																		
Description Work Order Deviation				Disposition				Completed By																	
								Lead hand / Supervisor Approval Verification																	
								QC / QA Coordinator Approval																	
Root Cause		FAULT CATEGORY																							
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ * Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐	OTHER : _____																			

Work Order ID 150877

Thursday, September 08, 2016 3:16:37 PM

150877

Page 7

Item ID: D119-646-041 Accept ***N900040100*** Setup Start ***NS1***
Revision ID: URF 15-560 Stop ***NS2***
Item Name: AW119 Replacement Skidtube with Wearpads - Fits LH or RH
Start Date: 11/2/2016 Start Qty: 1.00 ***1*** Cust Item ID:
Required Date: 11/23/2016 Req'd Qty: 1.00 ***1*** Customer:
Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
160		0.00							
160									
Skidtubes									
Skidtubes	Memo	0.00							
	NOTE:TACK IN 2 MOST FWD X-BOLT SPACERS AND TEST FIT FWD GROUND HANDELING FIXTURE,IF FIXTURE FITS WELL THEN PROCEED. FIXTURE DT10091.								
	1-Insert crossbolt spacers. Weld as per QSI 004 and Dwg D3887. Remember to back drill each hole before welding the other side. Use aluminum rod A/RAluminum Rod <u>MB4826</u>								
	2-Grind cross bolt welds flush as per Dwg D3887. Ensure no pin hole.								
	3-Counterbore 5/16" x 0.750" deep as per Dwg D3887.								
	4- Deburr & Scribe batch # on Aft end of tube.								
170	QC5- Inspect part completeness to step on W/O	0.00							
170									
QC	Memo	0.00							
Quality Control	TEST FIT USING FIXTURE DT10091.								

BE/16-10-24

BE/16-10-26 JH

① 16-10-28

DAS
9
9-89

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date : _____		Step #: _____		QTY Effective : _____		MRB (QSI042) Approval 	
Description Work Order Deviation				Disposition			
				Completed By _____			
				Lead hand / Supervisor Approval Verification _____			
				QC / QA Coordinator Approval _____			
Root Cause		FAULT CATEGORY					
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐						
OTHER : _____							

Work Order ID 150877***150877***

Page 8

Thursday, September 08, 2016 3:16:37 PM

Item ID: D119-646-041 Accept ***N900040100*** Setup Start ***NS1***
Revision ID: URF 15-560 Stop ***NS2***
Item Name: AW119 Replacement Skidtube with Wearpads - Fits LH or RH
Start Date: 11/2/2016 Start Qty: 1.00 ***1*** Cust Item ID:
Required Date: 11/23/2016 Req'd Qty: 1.00 ***1*** Customer:
Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
180	QC10- Inspect visual per QSI004- ground welds	0.00							
180									DAS
QC	Memo	0.00							9
Quality Control									9-89
	N/A								
190	Pressure Wash per QSI005 4.3	0.00							
190									
HandFinish	Memo	0.00							
Hand Finishing	Re-alodine tube as per QSI 005 section 4.1.2.1 do not acid etch.								
200	White Gloss(Ref:4.3.5.1) per QSI005 4.3-Alum	0.00							
200									
Powdercoat	Memo	0.00							
Powder Coating									

continue on
w/o 152530SEE
AttachedSTART TIME: _____
OVEN TEMPERATURE: _____
FINISH TIME: _____

DQA: _____ Date: _____

**WORK ORDER NON-CONFORMANCE / UPDATE**

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date : _____	Step #: _____	QTY Effective : _____		MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval	
Description Work Order Deviation		Disposition			

Root Cause		FAULT CATEGORY			
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐
Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____			
Misidentified ☐	Past Due ☐				

Work Order ID 150877***150877***

Page 9

Thursday, September 08, 2016 3:16:37 PM

Item ID: D119-646-041 Accept

N900040100Setup Start ***NS1***

Revision ID: URF 15-560

Stop ***NS2***

Item Name: AW119 Replacement Skidtube with Wearpads - Fits LH or RH

Start Date: 11/2/2016 Start Qty: 1.00 ***1***

Cust Item ID:

Required Date: 11/23/2016 Req'd Qty: 1.00 ***1***

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
210	QC3- Inspect Part Finish	0.00							
210									
QC	Memo	0.00							
Quality Control									
220		0.00							
220									
HandFinish	Memo	0.00							
Hand Finishing	1-Install inserts as per Dwg D3887.								
230	QC5- Inspect part completeness to step on W/O	0.00							
230									
QC	Memo	0.00							
Quality Control									

continue on
w/o 152530

N/A

DQA: _____ Date: _____

**WORK ORDER NON-CONFORMANCE / UPDATE**

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval		
Description Work Order Deviation				Disposition					

Root Cause				FAULT CATEGORY			
Environment ☐	☐	No Re-verification ☐	☐	Pressure/Forced ☐	☐	Temperature/Cure ☐	☐
Design ☐	☐	Operator ☐	☐	Bending ☐	☐	Set-up ☐	☐
Doc/Data ☐	☐	Offset/Setup ☐	☐	Centre Not Concentric ☐	☐	BOM/Route ☐	☐
Equip/Tooling ☐	☐	Supplier ☐	☐	Cracks ☐	☐	Broken/Damage/Defect ☐	☐
Handling/Pre ☐	☐	Training ☐	☐	Crimp/Kink/Ripple/Wave ☐	☐	Inspection Incomplete/Unqualified ☐	☐
Material ☐	☐	Use for Testing ☐	☐	Cuffs ☐	☐	Contamination ☐	☐
Internal Transport ☐	☐	Poor Information ☐	☐	Crushing ☐	☐	Countersink ☐	☐
Tribal Knowledge ☐	☐	Rushing ☐	☐	Heat Treat ☐	☐	Cut Too Short ☐	☐
LOA ☐	☐	Product Improvement ☐	☐	Wave/Twist in Tube ☐	☐	Instructions Incomplete/Unclear ☐	☐
Substation ☐	☐	Process Improvement ☐	☐	Marks/Chatter ☐	☐	Drill Holes ☐	☐
Past Expiry Date ☐	☐	Manufacturing Process ☐	☐	OTHER :			
* Misidentified ☐	☐	Past Due ☐	☐				

Work Order ID 150877***150877***

Page 10

Thursday, September 08, 2016 3:16:37 PM

Item ID: D119-646-041 Accept ***N900040100*** Setup Start ***NS1***
Revision ID: URF 15-560 Stop ***NS2***
Item Name: AW119 Replacement Skidtube with Wearpads - Fits LH or RH
Start Date: 11/2/2016 Start Qty: 1.00 ***1*** Cust Item ID:
Required Date: 11/23/2016 Req'd Qty: 1.00 ***1*** Customer:
Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center-ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
240		0.00							
240									
HandFinish									
Hand Finishing									
	Memo	0.00							
	1-Install wearpads, gaskets as per Dwg D3887. Put sikaflex in insert before installing bolts and washers A/R Sikaflex-240/-291 _____ Sikaflex expire date: _____								
	2-assemble o'ring to plug as per dwg D3492 and apply o'ring lube A/R 55-o'ring lube batch: _____								
	3 -Inspect for foreign objects as per QSI 024								
	4 -Install Aft Cap and seal with Sikaflex. Clean excess adhesive. A/R Sikaflex-240/-291 _____ Sikaflex expire date: _____								
245	QC5- Inspect part completeness to step on W/O	0.00							
245									
QC	Memo	0.00							
Quality Control									

SEE Attached

N/A

continue on
w/o 152530

DQA: _____ Date: _____

**WORK ORDER NON-CONFORMANCE / UPDATE**

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date : _____		Step #: _____		QTY Effective : _____			MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval		
Description Work Order Deviation				Disposition					

Root Cause				FAULT CATEGORY			
Environment ☐	☐ No Re-verification	☐ Pressure/Forced	☐ Temperature/Cure	☐ Power Loss/Surge	☐ Positioned Wrong		
Design ☐	☐ Operator	☐ Bending	☐ Set-up	☐ Folio/Program	☐ Outside Dimensions		
Doc/Data ☐	☐ Offset/Setup	☐ Centre Not Concentric	☐ BOM/Route	☐ Grain	☐ Over/Under tolerance		
Equip/Tooling ☐	☐ Supplier	☐ Cracks	☐ Broken/Damage/Defect	☐ Weld	☐ Part Incorrect		
Handling/Pre ☐	☐ Training	☐ Crimp/Kink/Ripple/Wave	☐ Inspection Incomplete/Unqualified	☐ Wrong Stock Pulled	☐ Part Lost/Missing		
Material ☐	☐ Use for Testing	☐ Cuffs	☐ Contamination	☐ Out of Sequence	☐ Part Moved		
Internal Transport ☐	☐ Poor Information	☐ Crushing	☐ Countersink	☐ Off-set	☐ Drawing		
Tribal Knowledge ☐	☐ Rushing	☐ Heat Treat	☐ Cut Too Short	☐ Mislabeled	☐ Finish		
LOA ☐	☐ Product Improvement	☐ Wave/Twist in Tube	☐ Instructions Incomplete/Unclear	☐ Fit/Function	☐ Misread		
Substation ☐	☐ Process Improvement	☐ Marks/Chatter	☐ Drill Holes	☐ Misaligned/off center	☐ Turning Sequence		
Past Expiry Date ☐	☐ Manufacturing Process	OTHER : _____					
Misidentified ☐	☐ Past Due						

Work Order ID 150877***150877***

Page 11

Thursday, September 08, 2016 3:16:37 PM

Item ID: D119-646-041 Accept ***N900040100*** Setup Start ***NS1***
Revision ID: URF 15-560 Stop ***NS2***
Item Name: AW119 Replacement Skidtube with Wearpads - Fits LH or RH
Start Date: 11/2/2016 Start Qty: 1.00 ***1*** Cust Item ID:
Required Date: 11/23/2016 Req'd Qty: 1.00 ***1*** Customer:
Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
250	Wing Walk as per dwg QSI005 4.4 Batch _____	0.00							
250									
HandFinish	Memo	0.00							
Hand Finishing									
251	QC5- Inspect part completeness to step on W/O	0.00							
251									
QC	Memo	0.00							
Quality Control									
260	Identify as per dwg & Stock Location: _____	0.00							
260									
Packaging	Memo	0.00							
Packaging									

continue on
w/o 152530
U/A

DQA: _____ Date: _____

**WORK ORDER NON-CONFORMANCE / UPDATE**

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval		
Description Work Order Deviation				Disposition					

Root Cause				FAULT CATEGORY			
Environment ☐	☐	No Re-verification ☐	☐	Pressure/Forced ☐	☐	Temperature/Cure ☐	☐
Design ☐	☐	Operator ☐	☐	Bending ☐	☐	Set-up ☐	☐
Doc/Data ☐	☐	Offset/Setup ☐	☐	Centre Not Concentric ☐	☐	BOM/Route ☐	☐
Equip/Tooling ☐	☐	Supplier ☐	☐	Cracks ☐	☐	Broken/Damage/Defect ☐	☐
Handling/Pre ☐	☐	Training ☐	☐	Crimp/Kink/Ripple/Wave ☐	☐	Inspection Incomplete/Unqualified ☐	☐
Material ☐	☐	Use for Testing ☐	☐	Cuffs ☐	☐	Contamination ☐	☐
Internal Transport ☐	☐	Poor Information ☐	☐	Crushing ☐	☐	Countersink ☐	☐
Tribal Knowledge ☐	☐	Rushing ☐	☐	Heat Treat ☐	☐	Cut Too Short ☐	☐
LOA ☐	☐	Product Improvement ☐	☐	Wave/Twist in Tube ☐	☐	Instructions Incomplete/Unclear ☐	☐
Substation ☐	☐	Process Improvement ☐	☐	Marks/Chatter ☐	☐	Drill Holes ☐	☐
Past Expiry Date ☐	☐	Manufacturing Process ☐	☐	OTHER : _____			
Misidentified ☐	☐	Past Due ☐	☐				

Work Order ID 150877***150877***

Page 12

Thursday, September 08, 2016 3:16:37 PM

Item ID: D119-646-041 Accept

N900040100Setup Start ***NS1***

Revision ID: URF 15-560

Stop ***NS2***

Item Name: AW119 Replacement Skidtube with Wearpads - Fits LH or RH

Start Date: 11/2/2016 Start Qty: 1.00 ***1***

Cust Item ID:

Required Date: 11/23/2016 Req'd Qty: 1.00 ***1***

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

270

QC21- Final Inspection - Work Order Release

0.00

270

QC

Memo

0.00

Quality Control

N/A

continue on
w/o 152530DAS
21
9-89

NOV 02 2016

Picklist Print

Thursday, September 08, 2016 3:16:36 PM

Page 1

Work Order ID: 150877

150877

Parent Item: D119-646-041

D119-646-041

Parent Item Name: AW119 Replacement Skidtube with Wearpads - Fits LH or RH

Start Date: 11/2/2016

Required Date: 11/23/2016

Start Qty: 1.00

Required Qty: 1.00

Comments: IPP RevA: New issue DD verified by:EC
10.02.22 per PAR 09-043 EC verified by:DD IPP rev B
DEOD3887-B-1)(ecn 12-675) DD verf:JLM IPP REV:D 12.11.05
chg003 ECN13-534 DD verf:JLM

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
---------------------------------	------------------------	---------------	-------------	---------------------	------------------	-----------------	--------------------	----------------	-------------	--------------	---------------	----------------	--------

D2500-1-190

Manufactured

No

110

Each

60.0000

1

1

D2500-1-190

Ext'n -1' Beam Tube 4"

**

16-10-13

Location

Loc Qty

Loc Code

HALL

60

145247

60

D2579

Manufactured

No

140

Each

137.0000

2

2

D2579

Crossbolt Spacer

**

BE 16-10-24

Location

Loc Qty

Loc Code

LG001

137

123997

1

141711

136

D2855-3

Manufactured

No

240

Each

73.0000

2

2

D2855-3

Cap

**

Location

Loc Qty

Loc Code

FP001

73

142564

73

W/O 152530

DQA: _____ Date: _____

**WORK ORDER NON-CONFORMANCE / UPDATE**

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval		
Description Work Order Deviation				Disposition					

Root Cause				FAULT CATEGORY			
Environment ☐	☐ No Re-verification	☐ Pressure/Forced	☐ Temperature/Cure	☐ Power Loss/Surge	☐ Positioned Wrong		
Design ☐	☐ Operator	☐ Bending	☐ Set-up	☐ Folio/Program	☐ Outside Dimensions		
Doc/Data ☐	☐ Offset/Setup	☐ Centre Not Concentric	☐ BOM/Route	☐ Grain	☐ Over/Under tolerance		
Equip/Tooling ☐	☐ Supplier	☐ Cracks	☐ Broken/Damage/Defect	☐ Weld	☐ Part Incorrect		
Handling/Pre ☐	☐ Training	☐ Crimp/Kink/Ripple/Wave	☐ Inspection Incomplete/Unqualified	☐ Wrong Stock Pulled	☐ Part Lost/Missing		
Material ☐	☐ Use for Testing	☐ Cuffs	☐ Contamination	☐ Out of Sequence	☐ Part Moved		
Internal Transport ☐	☐ Poor Information	☐ Crushing	☐ Countersink	☐ Off-set	☐ Drawing		
Tribal Knowledge ☐	☐ Rushing	☐ Heat Treat	☐ Cut Too Short	☐ Mislabeled	☐ Finish		
LOA ☐	☐ Product Improvement	☐ Wave/Twist in Tube	☐ Instructions Incomplete/Unclear	☐ Fit/Function	☐ Misread		
Substation ☐	☐ Process Improvement	☐ Marks/Chatter	☐ Drill Holes	☐ Misaligned/off center	☐ Turning Sequence		
Past Expiry Date ☐	☐ Manufacturing Process	OTHER :					
Misidentified ☐	☐ Past Due						

Picklist Print

Thursday, September 08, 2016 3:16:36 PM

Work Order ID: 150877

150877

Parent Item: D119-646-041

D119-646-041

Parent Item Name: AW119 Replacement Skidtube with Wearpads - Fits LH or RH

Start Date: 11/2/2016

Required Date: 11/23/2016

Start Qty: 1.00

Required Qty: 1.00

NAS1611-005

Purchased

No

240

Each

216.0000

16

16

NAS1611-005

O-RING

Location

Loc Qty

Loc Code

FP001

216

m129198

11

m133498

81

m134816

24

m135465

100

D3492-5

Manufactured

No

240

Each

229.0000

16

16

D3492-5

Plug

Location

Loc Qty

Loc Code

FP001

229

133396

8

136396

6

138198

2

142818

14

145446

199

D3672-1

Manufactured

No

240

Each

1,246.000

2

2

D3672-1

Washer, Phenolic

Location

Loc Qty

Loc Code

FG

10

85222

10

FP001

928

112218

4

134785

424

150074

500

ST049

308

147077

308

DQA: _____ Date: _____

**WORK ORDER NON-CONFORMANCE / UPDATE**

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval		
Description Work Order Deviation				Disposition					

Root Cause				FAULT CATEGORY			
Environment ☐	☐ No Re-verification	☐ Pressure/Forced	☐ Temperature/Cure	☐ Power Loss/Surge	☐ Positioned Wrong		
Design ☐	☐ Operator	☐ Bending	☐ Set-up	☐ Folio/Program	☐ Outside Dimensions		
Doc/Data ☐	☐ Offset/Setup	☐ Centre Not Concentric	☐ BOM/Route	☐ Grain	☐ Over/Under tolerance		
Equip/Tooling ☐	☐ Supplier	☐ Cracks	☐ Broken/Damage/Defect	☐ Weld	☐ Part Incorrect		
Handling/Pre ☐	☐ Training	☐ Crimp/Kink/Ripple/Wave	☐ Inspection Incomplete/Unqualified	☐ Wrong Stock Pulled	☐ Part Lost/Missing		
Material ☐	☐ Use for Testing	☐ Cuffs	☐ Contamination	☐ Out of Sequence	☐ Part Moved		
Internal Transport ☐	☐ Poor Information	☐ Crushing	☐ Countersink	☐ Off-set	☐ Drawing		
Tribal Knowledge ☐	☐ Rushing	☐ Heat Treat	☐ Cut Too Short	☐ Mislabeled	☐ Finish		
LOA ☐	☐ Product Improvement	☐ Wave/Twist in Tube	☐ Instructions Incomplete/Unclear	☐ Fit/Function	☐ Misread		
Substation ☐	☐ Process Improvement	☐ Marks/Chatter	☐ Drill Holes	☐ Misaligned/off center	☐ Turning Sequence		
Past Expiry Date ☐	☐ Manufacturing Process	OTHER : _____					
* Misidentified ☐	☐ Past Due						

Picklist Print

Thursday, September 08, 2016 3:16:36 PM

Work Order ID: 150877

150877

Parent Item: D119-646-041

D119-646-041

Parent Item Name: AW119 Replacement Skidtube with Wearpads - Fits LH or RH

Start Date: 11/2/2016

Required Date: 11/23/2016

Start Qty: 1.00

Required Qty: 1.00

D3681-1 Manufactured No

160 Each

129.0000 8 8

D3681-1

Spacer

BE16-10-24

Location

Loc Qty

Loc Code

LG001

129

145956

1

147557

48

148201

80

240 Each

78.0000 5 5

D3847-1 Manufactured No

D3847-1

Wearpad

Location

Loc Qty

Loc Code

FP001

78

138338

10

142854

2

145857

5

145858

9

145859

30

148686

22

240 Each

21.0000 1 1

D3847-11 Manufactured No

D3847-11

Wearpad

Location

Loc Qty

Loc Code

FP001

21

138418

1

142783

19

146945

1

w/o 152530

DQA: _____ Date: _____

**WORK ORDER NON-CONFORMANCE / UPDATE**

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition				Completed By	
								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____							
Misidentified ☐	Past Due ☐								

Picklist Print

Page 4

Thursday, September 08, 2016 3:16:36 PM

Work Order ID: 150877

150877

Parent Item: D119-646-041

D119-646-041

Parent Item Name: AW119 Replacement Skidtube with Wearpads - Fits LH or RH

Start Date: 11/2/2016

Required Date: 11/23/2016

Start Qty: 1.00

Required Qty: 1.00

D3885-1

Manufactured No

140

Each

23.0000

1

1

D3885-1

Standard Web

Location

Loc Qty

Loc Code

LG002

23

142573

3

146232

20

D3903-1

Manufactured No

160

Each

51.0000

12

12

D3903-1

Spacer

Location

Loc Qty

Loc Code

LG001

51

142730

7

148673

44

ALS4-1032-130

AELS4-1032-130 Purchased

No

220

Each

5,435.000

30

30

ALS4-1032-130

Rivnut

Location

Loc Qty

Loc Code

CCK004

4400

M135442

4400

FG

50

FG

M135442

50

FP001

529

M133077

122

M134502

407

ST556

456

M135442

456

16-10-2012

BE 16-10-24
B150281 *12

who
152530

Thursday, September 08, 2016 3:16:37 PM

Shop Packet Print

Page 4

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval		
Description Work Order Deviation				Disposition					
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐		OTHER : ☐					

Picklist Print

Page 5

Thursday, September 08, 2016 3:16:37 PM

Work Order ID: 150877

150877

Parent Item: D119-646-041

D119-646-041

Parent Item Name: AW119 Replacement Skidtube with Wearpads - Fits LH or RH

Start Date: 11/2/2016

Required Date: 11/23/2016

Start Qty: 1.00

Required Qty: 1.00

AN3C5A

Purchased

No

240

Each

1,209.000

32

32

AN3C5A

Bolt

Location

Loc Qty

Loc Code

FG

5

122800

5

FP001

131

M134955

106

M135470

25

OVER002

800

M135297

600

M135442

200

ST350

273

M133234

1

M134676

272

NAS1149C0332R

Purchased

No

Each

3,982.000

32

NAS1149C0332R

WASHER

Location

Loc Qty

Loc Code

FP001

1344

m135274

1344

GA

137

m133284

137

ST260a

2000

m135408

1000

m135466

1000

ST266

501

m134736

501

Thursday, September 08, 2016 3:16:37 PM

Shop Packet Print

Page 5

DQA: _____ Date: _____

**WORK ORDER NON-CONFORMANCE / UPDATE**

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval		
Description Work Order Deviation				Disposition					

Root Cause				FAULT CATEGORY			
Environment ☐	☐	No Re-verification ☐		☐	Temperature/Cure ☐	☐	Power Loss/Surge ☐
Design ☐	☐	Operator ☐		☐	Set-up ☐	☐	Folio/Program ☐
Doc/Data ☐	☐	Offset/Setup ☐	☐	Pressure/Forced ☐	BOM/Route ☐	☐	Grain ☐
Equip/Tooling ☐	☐	Supplier ☐	☐	Bending ☐	Broken/Damage/Defect ☐	☐	Weld ☐
Handling/Pre ☐	☐	Training ☐	☐	Centre Not Concentric ☐	Inspection Incomplete/Unqualified ☐	☐	Wrong Stock Pulled ☐
Material ☐	☐	Use for Testing ☐	☐	Cracks ☐	Contamination ☐	☐	Out of Sequence ☐
Internal Transport ☐	☐	Poor Information ☐	☐	Crimp/Kink/Ripple/Wave ☐	Countersink ☐	☐	Off-set ☐
Tribal Knowledge ☐	☐	Rushing ☐	☐	Cuffs ☐	Cut Too Short ☐	☐	Mislabeled ☐
LOA ☐	☐	Product Improvement ☐	☐	Crushing ☐	Instructions Incomplete/Unclear ☐	☐	Fit/Function ☐
Substation ☐	☐	Process Improvement ☐	☐	Heat Treat ☐	Drill Holes ☐	☐	Misaligned/off center ☐
Past Expiry Date ☐	☐	Manufacturing Process ☐	☐	Wave/Twist in Tube ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐		
Misidentified ☐	☐	Past Due ☐	☐	Marks/Chatter ☐			
OTHER : ☐							

Picklist Print

Thursday, September 08, 2016 3:16:37 PM

Work Order ID: 150877

150877

Parent Item: D119-646-041

D119-646-041

Parent Item Name: AW119 Replacement Skidtube with Wearpads - Fits LH or RH

Start Date: 11/2/2016

Required Date: 11/23/2016

Start Qty: 1.00

Required Qty: 1.00

MS24694-C52

Purchased

No

Each

85.0000

2

MS24694-C52

SCREW

WO 152530

Location

Loc Qty

Loc Code

FP001

29

m127059

17

m133855

12

ST285

50

m135466

50

ST287

6

124308

6

DQA: _____ Date: _____




WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval		
Description Work Order Deviation				Disposition					

Root Cause			FAULT CATEGORY			
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐	
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐	
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐	
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐	
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐	
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐	
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐	
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐	
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐	
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐	
Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____				
Misidentified ☐	Past Due ☐					

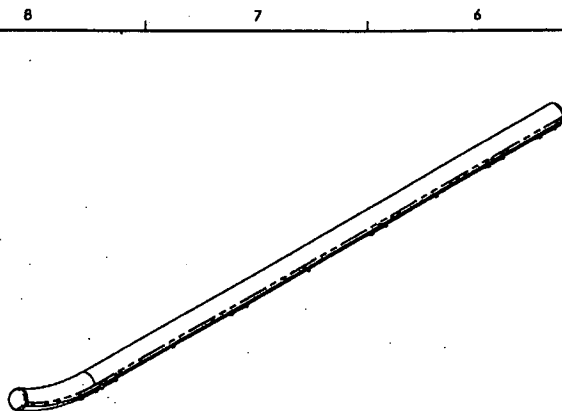

D3887-041 STANDARD SKIDTUBE ASSY WITH WEARPAD (SHOWN)
D3887-043 STANDARD SKIDTUBE ASSY WITH WEAPLATE (SIMILAR)
D3887-045 STANDARD SKIDTUBE ASSY WITH TRAINING WEARPLATE (SIMILAR)

ITEM	QTY -041	QTY -043	QTY -045	P/N	DESCRIPTION
1	X			D3887-041	STD SKIDTUBE ASSY WITH WEARPAD
2		X		D3887-043	STD SKIDTUBE ASSY WITH WEARPLATE
3			X	D3887-045	STD SKIDTUBE ASSY WITH TRAINING WEARPLATE
10	2	2	2	D2579	CROSS BOLT SPACER
11	2	2	2	D2855-3	CAP
12	16	16		D3492-045	PLUG ASSY
13	2	2	2	D3872-1	PHENOLIC WASHER
14	8	8	8	D3881-1	SPACER
17	5	5		D3847-1	WEARPAD
18	1	1		D3847-11	AFT WEARPAD
19		1		D3847-043	FWD WEARPLATE ASSY
20		1		D3847-045	CENTER WEARPLATE ASSY
21		1		D3847-047	AFT WEARPLATE ASSY
22			1	D3849-041	FWD TRAINING WEARPLATE ASSY
23			1	D3849-043	AFT WEARPLATE ASSY
24	1	1	1	D3885-1	STANDARD WEB
25	1	1		D3887-11	STANDARD SKIDTUBE
26			1	D3887-13	STANDARD SKIDTUBE
27	12	12	12	D3903-1	SPACER
28			18	D3904-1	WASHER
41	30	30		AL84-1032-130	INSERT
42	32	32	2	AN3C5A	BOLT
43			8	AN3C48A	BOLT
44	32	32		NAS1149C0332R	WASHER (OR AN980C10L)
45			8	MS21043-3	NUT
46	2	2	2	MS24894-C52	SCREW

NOTES:

- 1) MATERIAL: N/A
- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1 PRIOR TO INSERTING D3885-1 WEB
POWDER COAT "WHITE" (4.3.5.1) PER DART QSI 005 4.3
BLACK ANTI-SKID PAINT AS INDICATED TO 0.5 ABOVE LOCATION RIDGE PER DART QSI 005 4.4
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX
- 6) IDENTIFICATION: NONE
- 7) WEIGHT: D3887-041 = 32.0 lbs
D3887-043 = 37.0 lbs
D3887-045 = 38.1 lbs
- 8) WELD PER DART QSI 004
- 9) DAMAGE TOLERANCE ON FWD BEND:
THERE SHOULD BE NO VISIBLE WRINKLES IN THE BEND FROM THE GROUND TO A HEIGHT OF 8.5 INCHES
ABOVE THE GROUND. IT IS ACCEPTABLE TO POLISH OUT GOUGES UP TO 0.020" DEEP IN THE BENT
PORTION OF THE TUBE. A MAXIMUM REDUCTION IN DIAMETER OF 0.150" IS ACCEPTABLE IN THE BENT
PORTION OF THE TUBE.
- 10) INSERT D3885-1 WEB TO LOCATION SHOWN OFF AFT END OF SKIDTUBE AND BOND WEB INTO OUTER TUBE
WITH SIKAFLEX-241/291 ADHESIVE PER DART QSI 015 BEFORE BENDING. ENSURE HOLES LINE-UP
- 11) INSERT D3492-045 PLUG ASSY INTO Ø0.197 HOLES (BOTH SIDES OF TUBE)
- 12) USE DART DRILL TEMPLATE DT8931 TO LOCATE AND DRILL Ø0.297 HOLES FOR WEARPLATE INSERTS.
INSTALL AELS-1032-130 INTO D3887-11 ONLY. INSTALL AN3C5A BOLTS AND NAS1149C0332R WASHERS
WITH SIKAFLEX-241/291.

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT

WITHOUT NOTICE
WORK ORDER

NO. 150877

8m 16/09/08

RELEASED

2014 NOV 24
ECN 14-028

UNDER REVIEW

15.04.30 URF15-560 AP

D	REVISED BEND TOLERANCES FOR MANUFACTURABILITY. 135.07 WAS 134.04 (ZN D5-8). ADD 6.07 (ZN C2-8). ADD 116.8 (ZN D5-8). DELETE GASKETS (BOM, SH 2)	DB	13.09.20
C	(SH 1) P/L ZN C2-2, C2-3, C2-4, C2-5, C2-6, C2-7, C2-8, C2-9, C2-10, C2-11, C2-12, C2-13, C2-14, C2-15, C2-16, C2-17, C2-18, C2-19, C2-20, C2-21, C2-22, C2-23, C2-24, C2-25, C2-26, C2-27, C2-28, C2-29, C2-30, C2-31, C2-32, C2-33, C2-34, C2-35, C2-36, C2-37, C2-38, C2-39, C2-40, C2-41, C2-42, C2-43, C2-44, C2-45, C2-46, C2-47, C2-48, C2-49, C2-50, C2-51, C2-52, C2-53, C2-54, C2-55, C2-56, C2-57, C2-58, C2-59, C2-60, C2-61, C2-62, C2-63, C2-64, C2-65, C2-66, C2-67, C2-68, C2-69, C2-70, C2-71, C2-72, C2-73, C2-74, C2-75, C2-76, C2-77, C2-78, C2-79, C2-80, C2-81, C2-82, C2-83, C2-84, C2-85, C2-86, C2-87, C2-88, C2-89, C2-90, C2-91, C2-92, C2-93, C2-94, C2-95, C2-96, C2-97, C2-98, C2-99, C2-100, C2-101, C2-102, C2-103, C2-104, C2-105, C2-106, C2-107, C2-108, C2-109, C2-110, C2-111, C2-112, C2-113, C2-114, C2-115, C2-116, C2-117, C2-118, C2-119, C2-120, C2-121, C2-122, C2-123, C2-124, C2-125, C2-126, C2-127, C2-128, C2-129, C2-130, C2-131, C2-132, C2-133, C2-134, C2-135, C2-136, C2-137, C2-138, C2-139, C2-140, C2-141, C2-142, C2-143, C2-144, C2-145, C2-146, C2-147, C2-148, C2-149, C2-150, C2-151, C2-152, C2-153, C2-154, C2-155, C2-156, C2-157, C2-158, C2-159, C2-160, C2-161, C2-162, C2-163, C2-164, C2-165, C2-166, C2-167, C2-168, C2-169, C2-170, C2-171, C2-172, C2-173, C2-174, C2-175, C2-176, C2-177, C2-178, C2-179, C2-180, C2-181, C2-182, C2-183, C2-184, C2-185, C2-186, C2-187, C2-188, C2-189, C2-190, C2-191, C2-192, C2-193, C2-194, C2-195, C2-196, C2-197, C2-198, C2-199, C2-200, C2-201, C2-202, C2-203, C2-204, C2-205, C2-206, C2-207, C2-208, C2-209, C2-210, C2-211, C2-212, C2-213, C2-214, C2-215, C2-216, C2-217, C2-218, C2-219, C2-220, C2-221, C2-222, C2-223, C2-224, C2-225, C2-226, C2-227, C2-228, C2-229, C2-230, C2-231, C2-232, C2-233, C2-234, C2-235, C2-236, C2-237, C2-238, C2-239, C2-240, C2-241, C2-242, C2-243, C2-244, C2-245, C2-246, C2-247, C2-248, C2-249, C2-250, C2-251, C2-252, C2-253, C2-254, C2-255, C2-256, C2-257, C2-258, C2-259, C2-260, C2-261, C2-262, C2-263, C2-264, C2-265, C2-266, C2-267, C2-268, C2-269, C2-270, C2-271, C2-272, C2-273, C2-274, C2-275, C2-276, C2-277, C2-278, C2-279, C2-280, C2-281, C2-282, C2-283, C2-284, C2-285, C2-286, C2-287, C2-288, C2-289, C2-290, C2-291, C2-292, C2-293, C2-294, C2-295, C2-296, C2-297, C2-298, C2-299, C2-300, C2-301, C2-302, C2-303, C2-304, C2-305, C2-306, C2-307, C2-308, C2-309, C2-310, C2-311, C2-312, C2-313, C2-314, C2-315, C2-316, C2-317, C2-318, C2-319, C2-320, C2-321, C2-322, C2-323, C2-324, C2-325, C2-326, C2-327, C2-328, C2-329, C2-330, C2-331, C2-332, C2-333, C2-334, C2-335, C2-336, C2-337, C2-338, C2-339, C2-340, C2-341, C2-342, C2-343, C2-344, C2-345, C2-346, C2-347, C2-348, C2-349, C2-350, C2-351, C2-352, C2-353, C2-354, C2-355, C2-356, C2-357, C2-358, C2-359, C2-360, C2-361, C2-362, C2-363, C2-364, C2-365, C2-366, C2-367, C2-368, C2-369, C2-370, C2-371, C2-372, C2-373, C2-374, C2-375, C2-376, C2-377, C2-378, C2-379, C2-380, C2-381, C2-382, C2-383, C2-384, C2-385, C2-386, C2-387, C2-388, C2-389, C2-390, C2-391, C2-392, C2-393, C2-394, C2-395, C2-396, C2-397, C2-398, C2-399, C2-400, C2-401, C2-402, C2-403, C2-404, C2-405, C2-406, C2-407, C2-408, C2-409, C2-410, C2-411, C2-412, C2-413, C2-414, C2-415, C2-416, C2-417, C2-418, C2-419, C2-420, C2-421, C2-422, C2-423, C2-424, C2-425, C2-426, C2-427, C2-428, C2-429, C2-430, C2-431, C2-432, C2-433, C2-434, C2-435, C2-436, C2-437, C2-438, C2-439, C2-440, C2-441, C2-442, C2-443, C2-444, C2-445, C2-446, C2-447, C2-448, C2-449, C2-450, C2-451, C2-452, C2-453, C2-454, C2-455, C2-456, C2-457, C2-458, C2-459, C2-460, C2-461, C2-462, C2-463, C2-464, C2-465, C2-466, C2-467, C2-468, C2-469, C2-470, C2-471, C2-472, C2-473, C2-474, C2-475, C2-476, C2-477, C2-478, C2-479, C2-480, C2-481, C2-482, C2-483, C2-484, C2-485, C2-486, C2-487, C2-488, C2-489, C2-490, C2-491, C2-492, C2-493, C2-494, C2-495, C2-496, C2-497, C2-498, C2-499, C2-500, C2-501, C2-502, C2-503, C2-504, C2-505, C2-506, C2-507, C2-508, C2-509, C2-510, C2-511, C2-512, C2-513, C2-514, C2-515, C2-516, C2-517, C2-518, C2-519, C2-520, C2-521, C2-522, C2-523, C2-524, C2-525, C2-526, C2-527, C2-528, C2-529, C2-530, C2-531, C2-532, C2-533, C2-534, C2-535, C2-536, C2-537, C2-538, C2-539, C2-540, C2-541, C2-542, C2-543, C2-544, C2-545, C2-546, C2-547, C2-548, C2-549, C2-550, C2-551, C2-552, C2-553, C2-554, C2-555, C2-556, C2-557, C2-558, C2-559, C2-560, C2-561, C2-562, C2-563, C2-564, C2-565, C2-566, C2-567, C2-568, C2-569, C2-570, C2-571, C2-572, C2-573, C2-574, C2-575, C2-576, C2-577, C2-578, C2-579, C2-580, C2-581, C2-582, C2-583, C2-584, C2-585, C2-586, C2-587, C2-588, C2-589, C2-590, C2-591, C2-592, C2-593, C2-594, C2-595, C2-596, C2-597, C2-598, C2-599, C2-600, C2-601, C2-602, C2-603, C2-604, C2-605, C2-606, C2-607, C2-608, C2-609, C2-610, C2-611, C2-612, C2-613, C2-614, C2-615, C2-616, C2-617, C2-618, C2-619, C2-620, C2-621, C2-622, C2-623, C2-624, C2-625, C2-626, C2-627, C2-628, C2-629, C2-630, C2-631, C2-632, C2-633, C2-634, C2-635, C2-636, C2-637, C2-638, C2-639, C2-640, C2-641, C2-642, C2-643, C2-644, C2-645, C2-646, C2-647, C2-648, C2-649, C2-650, C2-651, C2-652, C2-653, C2-654, C2-655, C2-656, C2-657, C2-658, C2-659, C2-660, C2-661, C2-662, C2-663, C2-664, C2-665, C2-666, C2-667, C2-668, C2-669, C2-670, C2-671, C2-672, C2-673, C2-674, C2-675, C2-676, C2-677, C2-678, C2-679, C2-680, C2-681, C2-682, C2-683, C2-684, C2-685, C2-686, C2-687, C2-688, C2-689, C2-690, C2-691, C2-692, C2-693, C2-694, C2-695, C2-696, C2-697, C2-698, C2-699, C2-700, C2-701, C2-702, C2-703, C2-704, C2-705, C2-706, C2-707, C2-708, C2-709, C2-710, C2-711, C2-712, C2-713, C2-714, C2-715, C2-716, C2-717, C2-718, C2-719, C2-720, C2-721, C2-722, C2-723, C2-724, C2-725, C2-726, C2-727, C2-728, C2-729, C2-730, C2-731, C2-732, C2-733, C2-734, C2-735, C2-736, C2-737, C2-738, C2-739, C2-740, C2-741, C2-742, C2-743, C2-744, C2-745, C2-746, C2-747, C2-748, C2-749, C2-750, C2-751, C2-752, C2-753, C2-754, C2-755, C2-756, C2-757, C2-758, C2-759, C2-760, C2-761, C2-762, C2-763, C2-764, C2-765, C2-766, C2-767, C2-768, C2-769, C2-770, C2-771, C2-772, C2-773, C2-774, C2-775, C2-776, C2-777, C2-778, C2-779, C2-780, C2-781, C2-782, C2-783, C2-784, C2-785, C2-786, C2-787, C2-788, C2-789, C2-790, C2-791, C2-792, C2-793, C2-794, C2-795, C2-796, C2-797, C2-798, C2-799, C2-800, C2-801, C2-802, C2-803, C2-804, C2-805, C2-806, C2-807, C2-808, C2-809, C2-810, C2-811, C2-812, C2-813, C2-814, C2-815, C2-816, C2-817, C2-818, C2-819, C2-820, C2-821, C2-822, C2-823, C2-824, C2-825, C2-826, C2-827, C2-828, C2-829, C2-830, C2-831, C2-832, C2-833, C2-834, C2-835, C2-836, C2-837, C2-838, C2-839, C2-840, C2-841, C2-842, C2-843, C2-844, C2-845, C2-846, C2-847, C2-848, C2-849, C2-850, C2-851, C2-852, C2-853, C2-854, C2-855, C2-856, C2-857, C2-858, C2-859, C2-860, C2-861, C2-862, C2-863, C2-864, C2-865, C2-866, C2-867, C2-868, C2-869, C2-870, C2-871, C2-872, C2-873, C2-874, C2-875, C2-876, C2-877, C2-878, C2-879, C2-880, C2-881, C2-882, C2-883, C2-884, C2-885, C2-886, C2-887, C2-888, C2-889, C2-890, C2-891, C2-892, C2-893, C2-894, C2-895, C2-896, C2-897, C2-898, C2-899, C2-900, C2-901, C2-902, C2-903, C2-904, C2-905, C2-906, C2-907, C2-908, C2-909, C2-910, C2-911, C2-912, C2-913, C2-914, C2-915, C2-916, C2-917, C2-918, C2-919, C2-920, C2-921, C2-922, C2-923, C2-924, C2-925, C2-926, C2-927, C2-928, C2-929, C2-930, C2-931, C2-932, C2-933, C2-934, C2-935, C2-936, C2-937, C2-938, C2-939, C2-940, C2-941, C2-942, C2-943, C2-944, C2-945, C2-946, C2-947, C2-948, C2-949, C2-950, C2-951, C2-952, C2-953, C2-954, C2-955, C2-956, C2-957, C2-958, C2-959, C2-960, C2-961, C2-962, C2-963, C2-964, C2-965, C2-966, C2-967, C2-968, C2-969, C2-970, C2-971, C2-972, C2-973, C2-974, C2-975, C2-976, C2-977, C2-978, C2-979, C2-980, C2-981, C2-982, C2-983, C2-984, C2-985, C2-986, C2-987, C2-988, C2-989, C2-990, C2-991, C2-992, C2-993, C2-994, C2-995, C2-996, C2-997, C2-998, C2-999, C2-1000, C2-1001, C2-1002, C2-1003, C2-1004, C2-1005, C2-1006, C2-1007, C2-1008, C2-1009, C2-1010, C2-1011, C2-1012, C2-1013, C2-1014, C2-1015, C2-1016, C2-1017, C2-1018, C2-1019, C2-1020, C2-1021, C2-1022, C2-1023, C2-1024, C2-1025, C2-1026, C2-1027, C2-1028, C2-1029, C2-1030, C2-1031, C2-1032, C2-1033, C2-1034, C2-1035, C2-1036, C2-1037, C2-1038, C2-1039, C2-1040, C2-1041, C2-1042, C2-1043, C2-1044, C2-1045, C2-1046, C2-1047, C2-1048, C2-1049, C2-1050, C2-1051, C2-1052, C2-1053, C2-1054, C2-1055, C2-1056, C2-1057, C2-1058, C2-1059, C2-1060, C2-1061, C2-1062, C2-1063, C2-1064, C2-1065, C2-1066, C2-1067, C2-1068, C2-1069, C2-1070, C2-1071, C2-1072, C2-1073, C2-1074, C2-1075, C2-1076, C2-1077, C2-1078, C2-1079, C2-1080, C2-1081, C2-1082, C2-1083, C2-1084, C2-1085, C2-1086, C2-1087, C2-1088, C2-1089, C2-1090, C2-1091, C2-1092, C2-1093, C2-1094, C2-1095, C2-1096, C2-1097, C2-1098, C2-1099, C2-1100, C2-1101, C2-1102, C2-1103, C2-1104, C2-1105, C2-1106, C2-1107, C2-1108, C2-1109, C2-1110, C2-1111, C2-1112, C2-1113, C2-1114, C2-1115, C2-1116, C2-1117, C2-1118, C2-1119, C2-1120, C2-1121, C2-1122, C2-1123, C2-1124, C2-1125, C2-1126, C2-1127, C2-1128, C2-1129, C2-1130, C2-1131, C2-1132, C2-1133, C2-1134, C2-1135, C2-1136, C2-1137, C2-1138, C2-1139, C2-1140, C2-1141, C2-1142, C2-1143, C2-1144, C2-1145, C2-1146, C2-1147, C2-1148, C2-1149, C2-1150, C2-1151, C2-1152, C2-1153, C2-1154, C2-1155, C2-1156, C2-1157, C2-1158, C2-1159, C2-1160, C2-1161, C2-1162, C2-1163, C2-1164, C2-1165, C2-1166, C2-1167, C2-1168, C2-1169, C2-1170, C2-1171, C2-1172, C2-1173, C2-1174, C2-1175, C2-1176, C2-1177, C2-1178, C2-1179, C2-1180, C2-1181, C2-1182, C2-1183, C2-1184, C2-1185, C2-1186, C2-1187, C2-1188, C2-1189, C2-1190, C2-1191, C2-1192, C2-1193, C2-1194, C2-1195, C2-1196, C2-1197, C2-1198, C2-1199, C2-1200, C2-1201, C2-1202, C2-1203, C2-1204, C2-1205, C2-1206, C2-1207, C2-1208, C2-1209, C2-1210, C2-1211, C2-1212, C2-1213, C2-1214, C2-1215, C2-1216, C2-1217, C2-1218, C2-1219, C2-1220, C2-1221, C2-1222, C2-1223, C2-1224, C2-1225, C2-1226, C2-1227, C2-1228, C2-1229, C2-1230, C2-1231, C2-1232, C2-1233, C2-1234, C2-1235, C2-1236, C2-1237, C2-1238, C2-1239, C2-1240, C2-1241, C2-1242, C2-1243, C2-1244, C2-1245, C2-1246, C2-1247, C2-1248, C2-1249, C2-1250, C2-1251, C2-1252, C2-1253, C2-1254, C2-1255, C2-1256, C2-1257, C2-1258, C2-1259, C2-1260, C2-1261, C2-1262, C2-1263, C2-1264, C2-1265, C2-1266, C2-1267, C2-1268, C2-1269, C2-1270, C2-1271, C2-1272, C2-1273, C2-1274, C2-1275, C2-1276, C2-1277, C2-1278, C2-1279, C2-1280, C2-1281, C2-1282, C2-1283, C2-1284, C2-1285, C2-1286, C2-1287, C2-1288, C2-1289, C2-1290, C2-1291, C2-1292, C2-1293, C2-1294, C2-1295, C2-1296, C2-1297, C2-1298, C2-1299, C2-1300, C2-1301, C2-1302, C2-1303, C2-1304, C2-1305, C2-1306, C2-1307, C2-1308, C2-1309, C2-1310, C2-1311, C2-1312, C2-1313, C2-1314, C2-1315, C2-1316, C2-1317, C2-1318, C2-1319		

AN3C5A BOLT
D3872-1 PHENOLIC WASHER
NAS1149C0332R WASHER
(1 PER SIDE)

SEAL WITH
SIKAFLEX-241/291

D2855-3 CAP

D3847-11
WEARPAD

1.5
1.5
2.00 DISTANCE TO D3885-1 WEB, REF

AN3C5A BOLT
NAS1149C0332R WASHER
24 PL

BLACK ANTI-SKID TO 0.5
ABOVE LOCATION RIDGE
TYP

11
Ø0.197
8 PL PER SIDE
REF

PLUG UNUSED INSERTS WITH
AN3C5A BOLT
NAS1149C0332R WASHER
8 PL

D3847-1
WEARPAD
5 PL

D2855-3 CAP

SEAL WITH
SIKAFLEX-241/291

MS24894-C52 SCREW
(1 PER SIDE)

D3887-041 STANDARD SKIDTUBE ASSY WITH WEARPAD
(MAKE FROM D3887-11)

UNDER REVIEW

15.04.30 URF15-560 AP

RELEASED

2014 NOV 24 *q*

DESIGN	RF	DART AEROSPACE USA, INC. KENT, WA	
DRAWN	DB		
CHECKED		DRAWING NO. D3887	REV. D SHEET 2 OF 8
MFG. APPR.		TITLE A119 STD SKIDTUBE ASSY	SCALE NTS
APPROVED		COPYRIGHT © 2008 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS UNCLASSIFIED AND CONFIDENTIAL, AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR REPRODUCED IN ANY FORM OR BY ANY MEANS WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	
DE APPR.			
DATE	13.09.20		

AN3C5A BOLT
D3872-1 PHENOLIC WASHER
NAS1149C0332R WASHER
(1 PER SIDE)

SEAL WITH
SIKAFLEX-241/291

D2855-3 CAP

D3847-11
WEARPAD

D3847-047
AFT WEARPLATE ASSY

AN3C5A BOLT
NAS1149C0332R WASHER
30 PL

D3847-045
CENTER WEARPLATE ASSY

D3847-043
FWD WEARPLATE ASSY

D3847-1
WEARPAD
5 PL

BLACK ANTI-SKID TO 0.6
ABOVE LOCATION RIDGE
TYP

11
Ø 0.197
8 PL PER SIDE
REF

1.5 1.5 1.5 1.5

2.00 DISTANCE TO D3885-1 WEB, REF

D2855-3 CAP

SEAL WITH
SIKAFLEX-241/291

MS24694-C52 SCREW
(1 PER SIDE)

D3887-043 STANDARD SKIDTUBE ASSY WITH WEARPLATE
(MAKE FROM D3887-11)

UNDER REVIEW

15.04.30 URF15-560 AP

RELEASED

2014 NOV 24 *q*

DESIGN	RF	DART AEROSPACE USA, INC. KENT, WA	
DRAWN	CB		
CHECKED	<i>[Signature]</i>	DRAWING NO. D3887	REV. D
MFG. APPR.	<i>[Signature]</i>	SHEET 3 OF 8	
APPROVED	<i>[Signature]</i>	TITLE	SCALE
DE APPR.	<i>[Signature]</i>	A119 STD SKIDTUBE ASSY	NTS
DATE	13.09.20	COPYRIGHT © 2009 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS UNCLASSIFIED AND IS SUPPLIED ON THE EXPRESS UNDERSTANDING THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

AN3C5A BOLT
D3672-1 PHENOLIC WASHER
NAS1149C0332R WASHER
(1 PER SIDE)

SEAL WITH
SIKAFLEX-241/281

D2855-3 CAP

AN3C46A BOLT
D3904-1 WASHER, 2 PL
MS21043-3 NUT
8 PL

D3849-043
AFT TRAINING WEARPLATE ASSY

BLACK ANTI-SKID TO 0.5
ABOVE LOCATION RIDGE
TYP

2.00 DISTANCE TO D3885-1 WEB

D3849-041
FWD TRAINING WEARPLATE ASSY

1.5 D2855-3 CAP

SEAL WITH
SIKAFLEX-241/281

MS24884-C52 SCREW
(1 PER SIDE)

UNDER REVIEW


15.04.30 URF15-560 AP


RELEASED

2014 NOV 24 *q*

D3887-045 STANDARD SKIDTUBE ASSY WITH TRAINING WEARPLATE
(MAKE FROM D3387-13)

DESIGN	RF	DART AEROSPACE USA, INC.	
DRAWN	DB	KENT, WA	
CHECKED	<i>[Signature]</i>	DRAWING NO. D3887	REV. D
MFG. APPR.	<i>[Signature]</i>	SHEET 4 OF 8	
APPROVED	<i>[Signature]</i>	TITLE	SCALE
DE APPR.	<i>[Signature]</i>	A119 STD SKIDTUBE ASSY	NTS
DATE	13.09.20	COPYRIGHT © 2009 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRELIMINARY AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSES OR COPIED OR DISSEMINATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

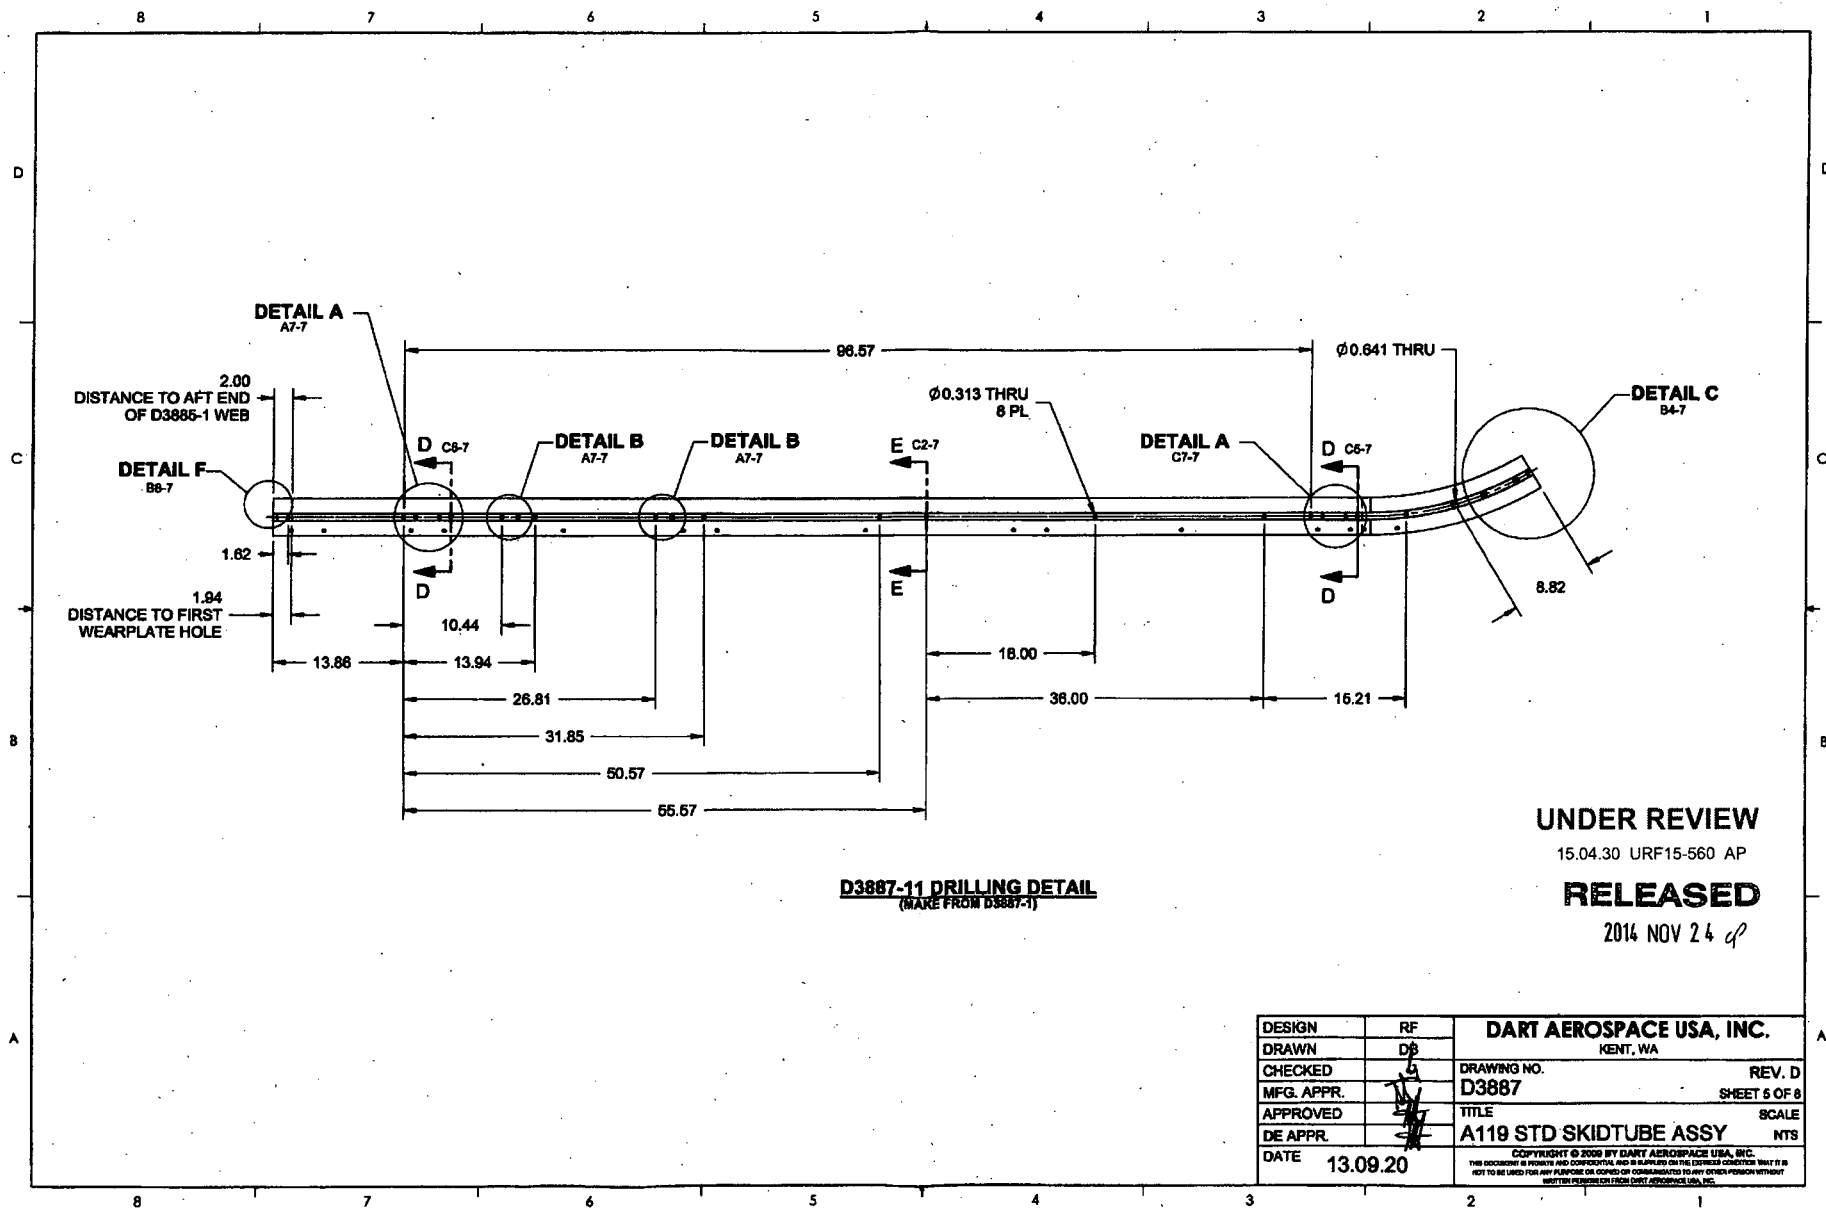

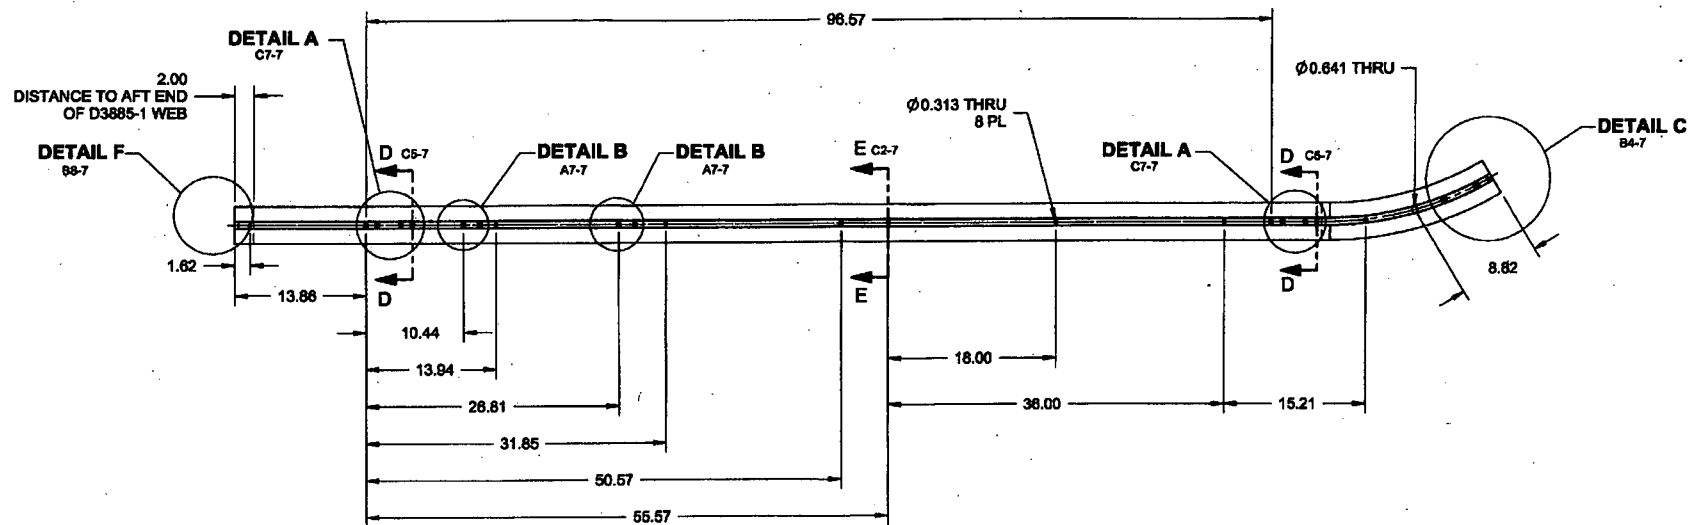

D3887-13 DRILLING DETAIL
(MAKE FROM D3887-1)


UNDER REVIEW

15.04.30 URF15-560 AP


RELEASED

2014 NOV 24 *ap*


DESIGN	RF	DART AEROSPACE USA, INC.	
DRAWN	DB	KENT, WA	
CHECKED		DRAWING NO.	REV. D
MFG. APPR.		D3887	SHEET 6 OF 8
APPROVED		TITLE	SCALE
DE APPR.		A119 STD SKIDTUBE ASSY	NTS
DATE	13.09.20	COPYRIGHT © 2009 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS UNCLASSIFIED AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE REPRODUCED OR COPIED IN ANY MANNER WITHOUT THE WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

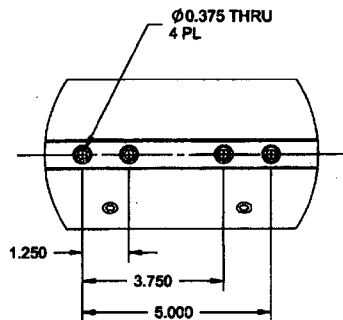


DETAIL A
SCALE 4X
D7-5
C3-6
D7-6
C3-6

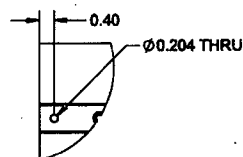


DETAIL F
SCALE 4X
C8-5
C8-6

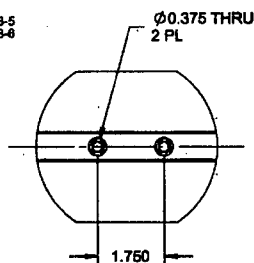

DETAIL B
SCALE 4X
C8-5
C5-5
C8-6
C5-6

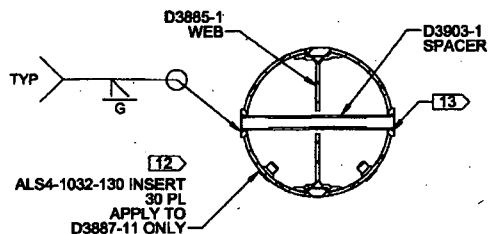


SECTION D-D
SCALE 4X
C7-5
C3-6
C7-6
C2-6
(FOR 12 X Ø0.375 HOLES PER SKIDTUBE)

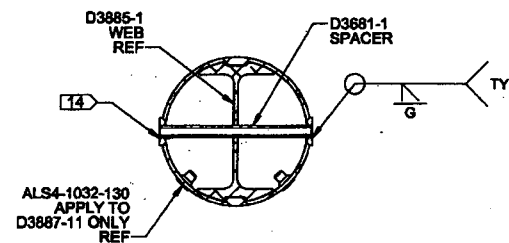

SECTION E-E
SCALE 4X
C4-5
C4-6
(FOR 8 X Ø0.313 HOLES PER SKIDTUBE)

NOTES:

- 13) AFTER DRILLING AND BENDING ASSEMBLY PERFORM THE FOLLOWING FOR Ø0.375 HOLES ONLY:
 i) CHAMFER HOLES Ø0.475 x 45°
 ii) INSERT D3903-1 SPACER
 iii) WELD INTO PLACE AND GRIND FLUSH
 iv) CBORE TO 0.313 x 0.75 DEEP
 v) DEBURR HOLES
- 14) AFTER DRILLING AND BENDING ASSEMBLY PERFORM THE FOLLOWING FOR Ø0.313 HOLES ONLY:
 vi) CHAMFER HOLES Ø0.354 x 45° OR 0.050 DEEP x 45° (BOTH SIDES)
 vii) INSERT D3681-1 SPACER
 viii) WELD INTO PLACE AND GRIND FLUSH
 ix) DEBURR HOLES

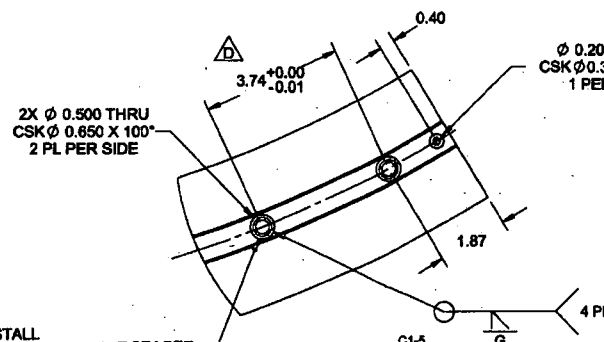

DETAIL C
TYPICAL
SCALE 4X
C1-5
C1-6


UNDER REVIEW

15.04.30 URF15-560 AP

RELEASED

2014 NOV 24 4P

DESIGN	RF	DART AEROSPACE USA, INC.	
DRAWN	DB	KENT, WA	
CHECKED	5	DRAWING NO.	REV. D
MFG. APPR.		D3887	SHEET 7 OF 8
APPROVED		TITLE	SCALE
DE APPR.		A119 STD SKIDTUBE ASSY	NTS
DATE	13.09.20	COPYRIGHT © 2009 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR REPRODUCED OR TRANSMITTED IN ANY FORM OR BY ANY MEANS WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

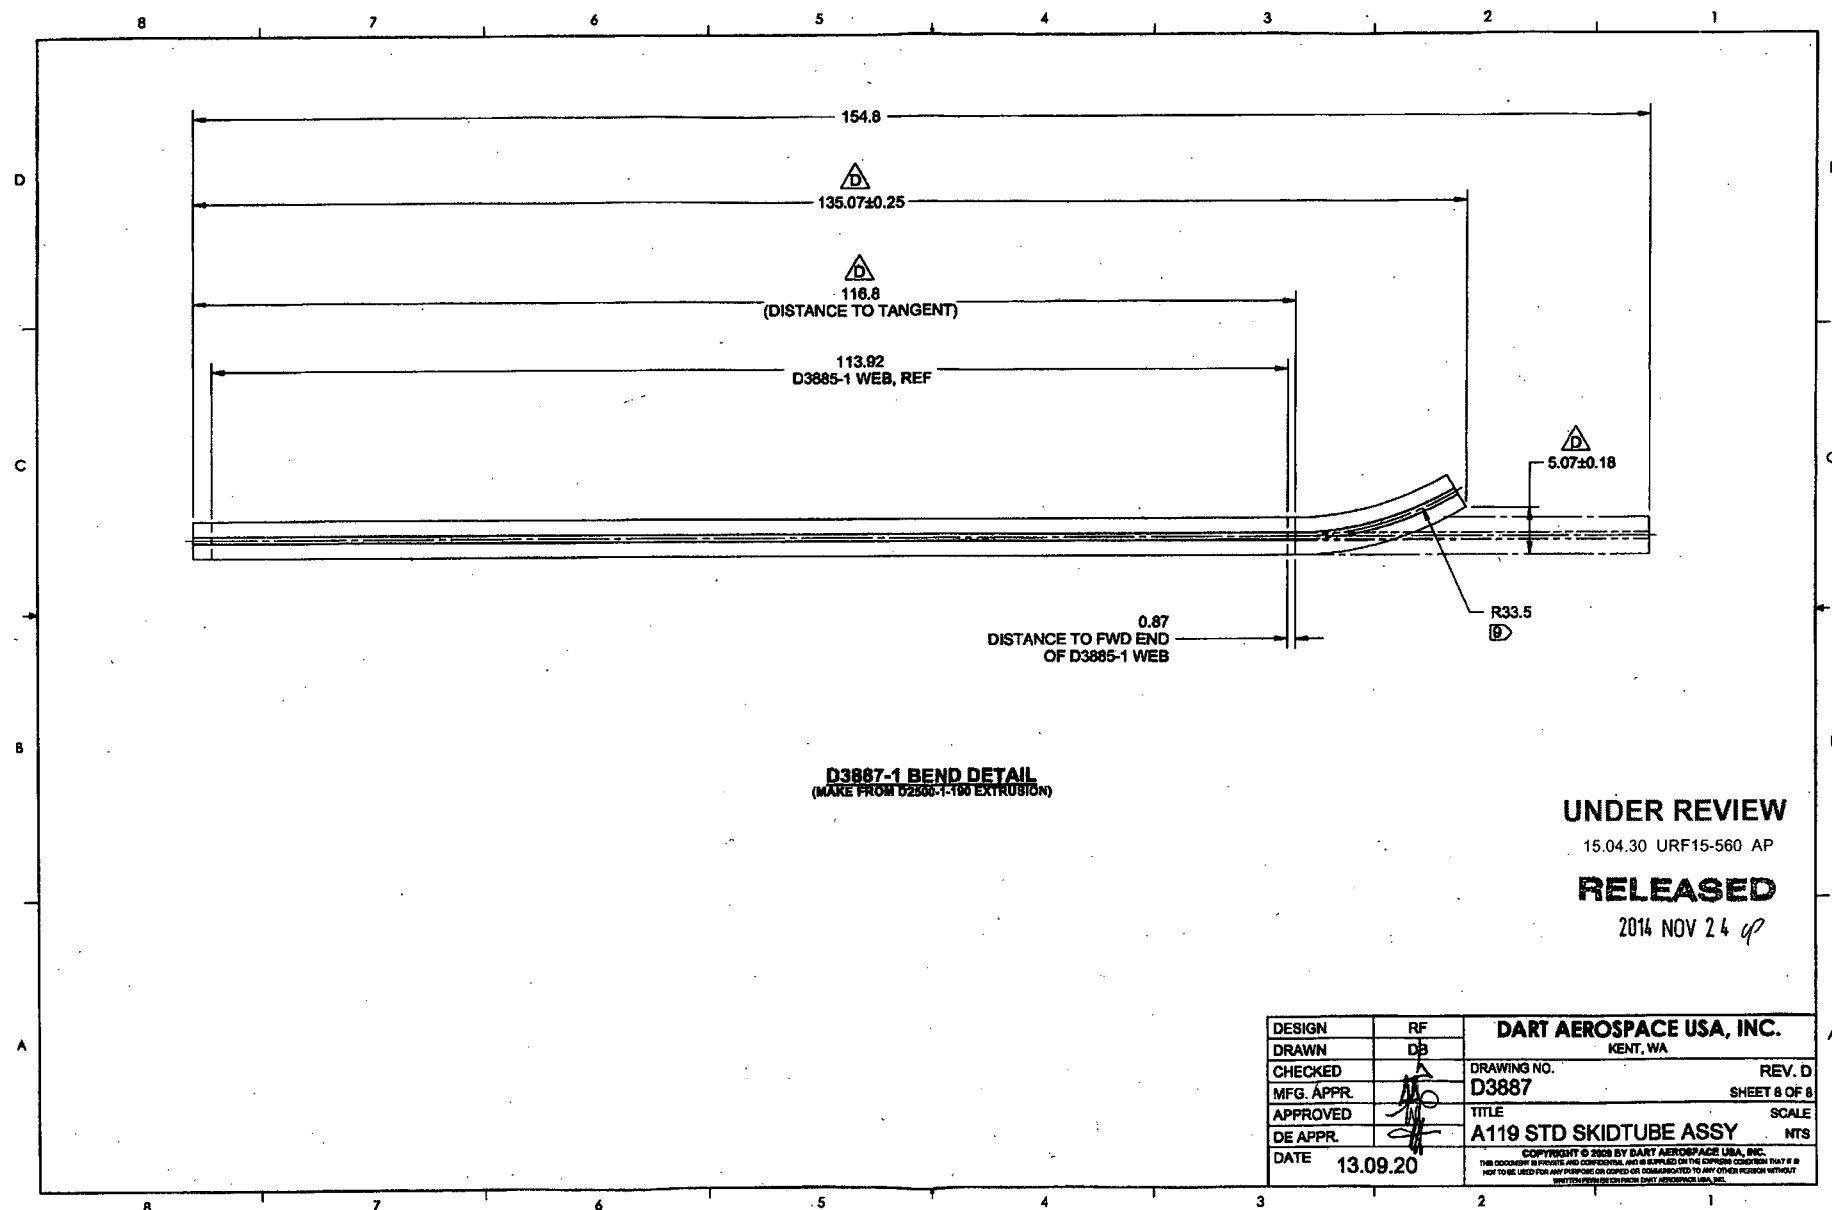

DQA:

Date: 2017-08-25

QA Closed:

Date:

APR 26 2017 WORK ORDER NON-CONFORMANCE / UPDATE

Work Order update only



Work Order: 150873		DISPOSITION		AGAINST DEPARTMENT/PROCESS					
Part No. D119-646-041		Rework ☒		Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☒		
NCR No. 17-13912		Scrap ☐		Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐		
		Use-as-is ☐		Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐		
		Suspected Unapproved ☐		Large Fab ☐	Composite ☐	Supplier ☐			
Date: 16/3/16		Step #: 240		QTY Effective: 1			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition				DAS 12 9-89 16/9/12	
Plug unused holes with AN3C4A Bolts rather than AN3C5A Bolts.				Acceptable AN3C4A (M13C986) (X)				Completed By: 15 18/08/12	
								Lead hand / Supervisor Approval Verification DAS 15 9-89 17-03-13	
								QC / QA Coordinator Approval DAS 9 9-89 17-03-13	
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☒	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	☒ Drawing				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐	OTHER: ☐							
Misidentified ☐	Past Due ☐								

DQA: _____ Date: _____

QA Closed: 14

Date: _____

APR 26 2011 WORK ORDER NON-CONFORMANCE / UPDATE

Work Order update only



Work Order: <u>150873</u> Part No. <u>D119-646-041</u> NCR No. <u>17-639</u>	DISPOSITION Rework ☒ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS <table style="width:100%;"> <tr> <td>Skid-tube ☐</td> <td>Cross tube ☐</td> <td>Water Jet ☐</td> <td>Engineering ☒</td> </tr> <tr> <td>Machining ☐</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coord. ☐</td> <td>Quality ☐</td> </tr> <tr> <td>Thermoforming ☐</td> <td>Finishing ☐</td> <td>Rec/Store/Packaging ☐</td> <td>Other ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Composite ☐</td> <td>Supplier ☐</td> <td></td> </tr> </table>			Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☒	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐																																																
Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☒																																																																
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐																																																																
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐																																																																
Large Fab ☐	Composite ☐	Supplier ☐																																																																	
Date: <u>16/5/16</u>	Step #: <u>200</u>	QTY Effective: <u>1</u>	MRB (QSI042) Approval DAS 12 9-89 <u>16/9/12</u>																																																																
Description Work Order Deviation No powder coat on saddle region per customer request.		Disposition Acceptable per attached Masking instructions																																																																	
		Completed By <u>17-03-13</u> <u>SAC</u> Lead hand / Supervisor Approval Verification DAS <u>9</u> 9-89 <u>17-03-13</u> QC / QA Coordinator Approval DAS <u>9</u> 9-89 <u>17-03-13</u>																																																																	
Root Cause <table style="width:100%;"> <tr> <td>Environment ☐</td> <td>No Re-verification ☐</td> </tr> <tr> <td>Design ☒</td> <td>Operator ☐</td> </tr> <tr> <td>Doc/Data ☐</td> <td>Offset/Setup ☐</td> </tr> <tr> <td>Equip/Tooling ☐</td> <td>Supplier ☐</td> </tr> <tr> <td>Handling/Pre ☐</td> <td>Training ☐</td> </tr> <tr> <td>Material ☐</td> <td>Use for Testing ☐</td> </tr> <tr> <td>Internal Transport ☐</td> <td>Poor Information ☐</td> </tr> <tr> <td>Tribal Knowledge ☐</td> <td>Rushing ☐</td> </tr> <tr> <td>LOA ☐</td> <td>Product Improvement ☐</td> </tr> <tr> <td>Substation ☐</td> <td>Process Improvement ☐</td> </tr> <tr> <td>Past Expiry Date ☐</td> <td>Manufacturing Process ☐</td> </tr> <tr> <td>Misidentified ☐</td> <td>Past Due ☐</td> </tr> </table>		Environment ☐	No Re-verification ☐	Design ☒	Operator ☐	Doc/Data ☐	Offset/Setup ☐	Equip/Tooling ☐	Supplier ☐	Handling/Pre ☐	Training ☐	Material ☐	Use for Testing ☐	Internal Transport ☐	Poor Information ☐	Tribal Knowledge ☐	Rushing ☐	LOA ☐	Product Improvement ☐	Substation ☐	Process Improvement ☐	Past Expiry Date ☐	Manufacturing Process ☐	Misidentified ☐	Past Due ☐	FAULT CATEGORY <table style="width:100%;"> <tr> <td>Pressure/Forced ☐</td> <td>Temperature/Cure ☐</td> <td>Power Loss/Surge ☐</td> <td>Positioned Wrong ☐</td> </tr> <tr> <td>Bending ☐</td> <td>Set-up ☐</td> <td>Folio/Program ☐</td> <td>Outside Dimensions ☐</td> </tr> <tr> <td>Centre Not Concentric ☐</td> <td>BOM/Route ☐</td> <td>Grain ☐</td> <td>Over/Under tolerance ☐</td> </tr> <tr> <td>Cracks ☐</td> <td>Broken/Damage/Defect ☐</td> <td>Weld ☐</td> <td>Part Incorrect ☐</td> </tr> <tr> <td>Crimp/Kink/Ripple/Wave ☐</td> <td>Inspection Incomplete/Unqualified ☐</td> <td>Wrong Stock Pulled ☐</td> <td>Part Lost/Missing ☐</td> </tr> <tr> <td>Cuffs ☐</td> <td>Contamination ☐</td> <td>Out of Sequence ☐</td> <td>Part Moved ☐</td> </tr> <tr> <td>Crushing ☐</td> <td>Countersink ☐</td> <td>Off-set ☐</td> <td>Drawing ☐</td> </tr> <tr> <td>Heat Treat ☐</td> <td>Cut Too Short ☐</td> <td>Mislabeled ☐</td> <td>Finish ☐</td> </tr> <tr> <td>Wave/Twist in Tube ☐</td> <td>Instructions Incomplete/Unclear ☐</td> <td>Fit/Function ☐</td> <td>Misread ☐</td> </tr> <tr> <td>Marks/Chatter ☐</td> <td>Drill Holes ☐</td> <td>Misaligned/off center ☐</td> <td>Turning Sequence ☐</td> </tr> </table>		Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐
Environment ☐	No Re-verification ☐																																																																		
Design ☒	Operator ☐																																																																		
Doc/Data ☐	Offset/Setup ☐																																																																		
Equip/Tooling ☐	Supplier ☐																																																																		
Handling/Pre ☐	Training ☐																																																																		
Material ☐	Use for Testing ☐																																																																		
Internal Transport ☐	Poor Information ☐																																																																		
Tribal Knowledge ☐	Rushing ☐																																																																		
LOA ☐	Product Improvement ☐																																																																		
Substation ☐	Process Improvement ☐																																																																		
Past Expiry Date ☐	Manufacturing Process ☐																																																																		
Misidentified ☐	Past Due ☐																																																																		
Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐																																																																
Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐																																																																
Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐																																																																
Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐																																																																
Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐																																																																
Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐																																																																
Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐																																																																
Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐																																																																
Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐																																																																
Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐																																																																
☒ OTHER: <u>Customer</u>																																																																			

